



**RUSSIAN FEDERATION
MINISTRY OF TRANSPORT OF RUSSIAN FEDERATION
FEDERAL AVIATION TRANSPORT AGENCY**

AIRWORTHINESS DIRECTIVE

December 29, 2021

№ 2021-FATA-01020A-08

Applicability –RRJ-95 aeroplanes

State of Design – Russian Federation

Corrective actions described herein are mandatory. No operator may operate an A/C to which this AD applies except in accordance with the requirements hereof.

On aeroplanes (AC) RRJ-95, the absence of lock of nuts and lock washers of longitudinal strut rods T7.92.0671.280.905.70/B and T7.92.0671.280.903.70/B by locking wire installed between frames 57 and 58 (Section F5) was detected. This discrepancy can lead to misalignment of the rods and subsequent damage to the longitudinal struts. In order to ensure Continued Airworthiness of Aeroplanes RRJ-95

IT IS PROPOSED:

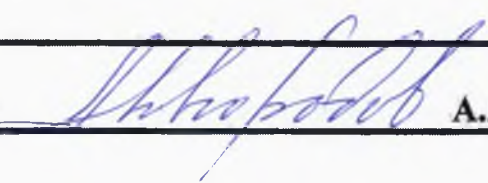
1. For RRJ-95 aeroplanes Serial numbers 95175, 95177, 95179 - 95185 within 8 days from the date of applicability of this Airworthiness Directive to perform the one-time inspection of the longitudinal strut rods T7.92.0671.280.905.70 / B and T7.92.0671.280.903.70 / B, installed in Section F5 and to inform PJSC Irkut Corporation in accordance with p. 1,2 of Technical Decision № RRJ-OR-053-0016 dated 22.12.2021 (attached).

This Directive shall be effective from the date of its signing.

Appendix: Technical Decision № RRJ0000-OR-053-0016 on 2 sheets.

Deputy Director

Federal Aviation Transport Agency


A.A. Novgorodov
